

| WORK INSTRUCTION: WI-1053  | PAGE 1 OF 16                |
|--|-----------------------------|
| DEPARTMENT:  | AUTHOR: JENNIFER BURKIZER   |
| PRODUCT LINE: INFLATORS  | ORIGINAL ISSUE DATE: 5/9/13 |
| <b>OPERATION: : </b> INFLATOR PACKAGING FOR CUSTOMER RETURNS SHIPPING BACK TO AMSAFE | REVIEWED BY: C. Wilkerson   |
| <b>DRAWING NO:</b> 514017, 514018, 510277  | APPROVED BY: K. Keeslar     |
| REVISION: -D   | REVISION DATE: 08/23/2018   |

| TOOLS REQUIRED   | COMPONENTS REQUIRED   |
|------------------|---|
| PACKING TAPE GUN | PACKING TAPE QTY 1 BOX  • 514017-1- 6 CELL CONFIGURATION • 514018-1- 12 CELL CONFIGURATION • 510277-1- 24 CELL CONFIGURATION QTY 5 ROLL END TRAYS • 514017-2- 6 CELL CONFIGURATION • 514018-2- 12 CELL CONFIGURATION • 510277-2- 24 CELL CONFIGURATION QTY 2 FOAM PADS • 514017-3- 6 CELL CONFIGURATION • 514018-3- 12 CELL CONFIGURATION • 510277-3- 24 CELL CONFIGURATION • 510277-3- 24 CELL CONFIGURATION QTY 5 VERTICAL INSERTS • N/A FOR 6 CELL CONFIGURATION • 514018-4- 12 CELL CONFIGURATION |

# -ALL INFLATORS MUST BE SHIPPED AS HAZARDOUS GOODS COMPLYING WITH LOCAL AND INTERNATIONAL TRANSPORTATION REGULATIONS-

#### NOTES:

- 1. HANDLE INFLATORS WITH GREAT CARE, DO NOT DROP.
- 2. ONLY INFLATORS ARE TO BE PACKED INSIDE OF THESE BOXES.
- 3. FOR P/N 508792-401\*\*, 510385-401\*\*, 508794-401\*\* AND 508793-401\*\*, 508795-401\*\* DO NOT PACK MORE THAN HALF OF THE ALLOWABLE POSITIONS FOR INFLATORS PER BOX (EXAMPLES: 24 POSITIONS=>12 INFLATORS, 12=>6, 6=>3).
- 4. FINAL BOX WEIGHT IS NOT TO EXCEED STAMPED RATING. REGARDLESS, NOT TO EXCEED 40 LBS.
- 5. IF PACKING FEWER INFLATORS THAN THE BOX CAN HOLD, DISTRIBUTE INFLATORS EVENLY THROUGHOUT BOX FOR WEIGHT DISTRIBUTION.
- 6. **WARNING**: SAFETY HAZARD; CONFIGURE INFLATORS AS FOLLOWS:
  - a. \*\*P/N 508792-401, 510385-401, 508794-401 AND 508793-401, 508795-401 INFLATORS <u>MUST HAVE</u> THE <u>P/N 508531-1 SHIPPING</u> CAP <u>INSTALLED</u> TO SHIP LEGALLY.
  - b. P/N 510226-401, 510184-401, 510183-401, AND 511878-401 <u>MUST HAVE</u> THE <u>HOSE ADAPTER REMOVED</u> <u>FROM THE INFLATOR TO SHIP LEGALLY.</u>
  - c. REMOVE ALL RESTRAINT HOSES FROM ALL INFLATORS BEING SHIPPED ALONG WITH "6a" AND/OR "6b" ABOVE.
  - d. REMOVE ALL CABLES FROM ALL INFLATORS.

### 1. PREPACKAGING - INFLATOR INSPECTION

a. P/N 508792-401\*\*, 510385-401\*\*, 508794-401\*\* AND 508793-401\*\*, 508795-401\*\* VERIFY THE PRESENCE OF THE P/N 508531-1

SHIPPING CAP









b. P/N 510226-401, 510184-401, 510183-401, AND 511878-401 MUST HAVE THE HOSE ADAPTER REMOVED FROM THE INFLATOR TO SHIP








c) Ensure all Hoses, Hose Fittings and electrical connections are removed from each inflator being shipped .



### 2. ASSEMBLE BOX AND TAPE THE BOTTOM CLOSED.


- FOR THE 6 CELL BOX USE 514017-1
- FOR THE 12 CELL BOX USE 514018-1
- FOR THE 24 CELL BOX USE 510277-1

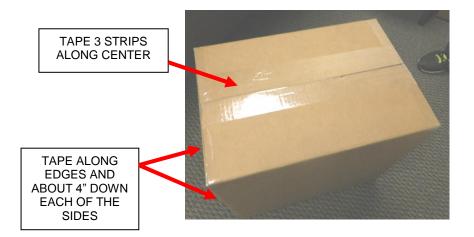




3. EACH BOX GETS 5 END TRAYS. ASSEMBLE EACH ROLL END TRAYS WITH A VERTICAL INSERTS IN EACH (EXCEPT THE 6 CELL BOX- 514017).

### FOR THE 6 CELL BOX USE 514017-2:

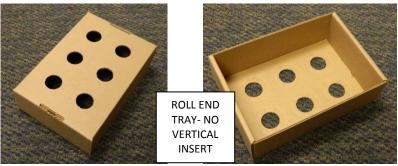


FOR THE 12 CELL BOX USE 514018-2, -4:

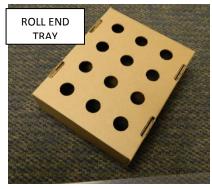







FOR THE 24 CELL BOX USE 510277-2, -4:

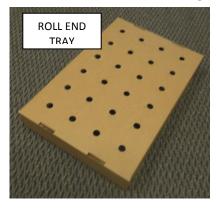



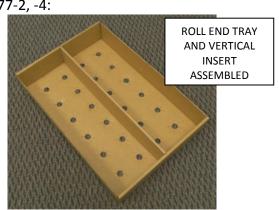



- 4. EACH BOX GETS 2 FOAM PADS. THE FOAM PADS SHOULD BE PACKED ON THE TOP AND BOTTOM ENDS OF THE INFLATORS.
  - FOR THE 6 CELL BOX QTY (2) USE 514017-3:
  - FOR THE 12 CELL BOX QTY (2) USE 514018-3:
  - FOR THE 24 CELL BOX QTY (2) USE 510277-3:

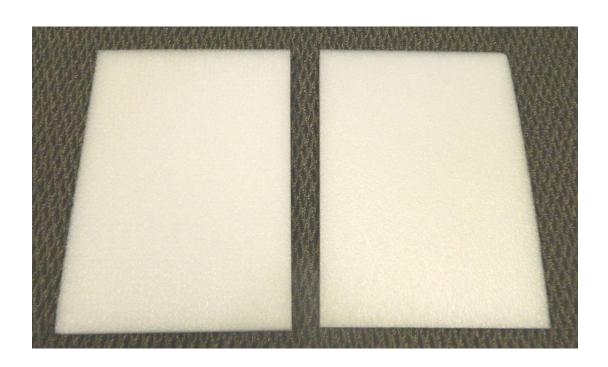

5. USING ONE OF THE SCHEMATICS BELOW THAT IS BASED ON INFLATOR LENGTHS; ASSEMBLE THE BOX WITH THE END TRAYS AND FOAM PADS. ALL PACKAGING COMPONENTS SHOULD FIT SNUGLY IN THE BOX.

## PACKING CONFIGURATIONS (CUT AWAY VIEWS)

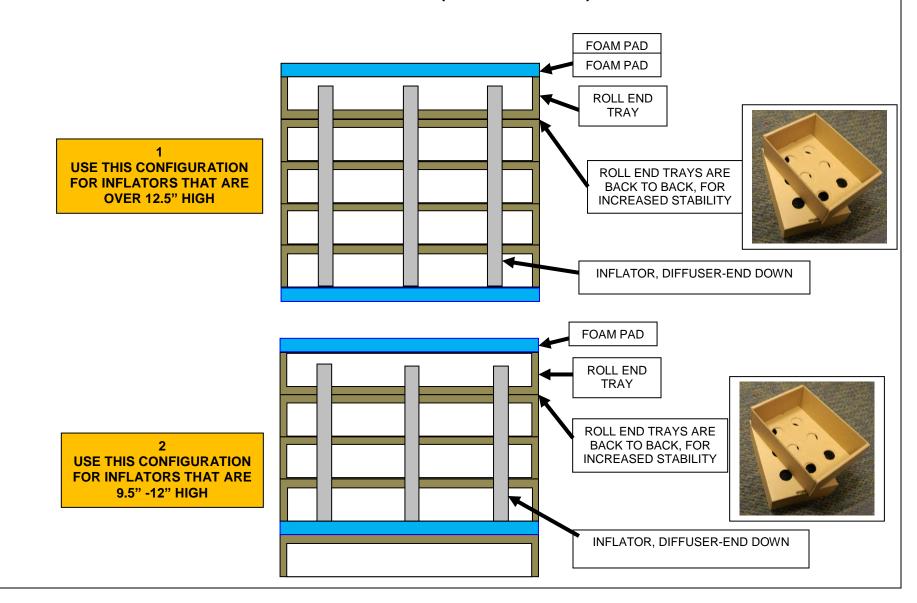

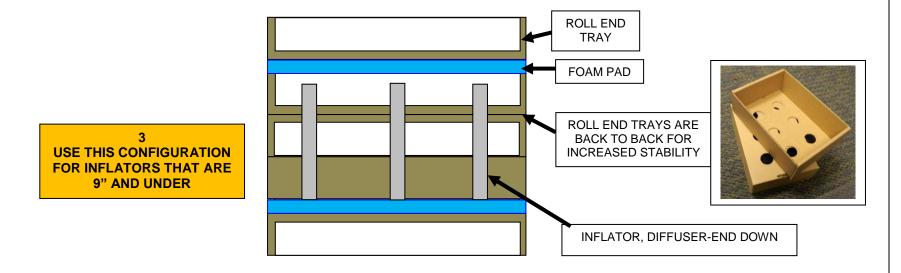




EXAMPLE – INSERT INFLATOR DIFFUSER-END DOWN (POLY BAGS REMOVED FOR CLARITY)



6. CLOSE BOX AND TAPE SHUT. LABEL PER REQUIREMENTS.
BEFORE CLOSING BOX ENSURE TOTAL PACAKGE WEIGHT DOES NOT EXCEED WEIGHT RATING STAMPED ON BOX AND ENSURE LABELING IS CORRECT.

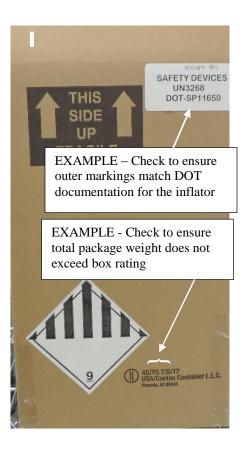





TAPE 3 STRIPS ALONG CENTER

> TAPE ALONG EDGES AND ABOUT 4" DOWN EACH OF THE SIDES

7. Include proper shipping documentation for the Inflator Assembly being returned; DOT, SDS, EGR-171:

| Inflator<br>Manufacturer | AmSafe Part<br>No. on<br>Inflator Label | DOT-<br>Hazardous<br>Goods<br>document | SDS                | ERG              |
|--------------------------|---|--|--------------------|------------------|
|                          | 508792-401                              | EX2007020369                           | 0_0                | =                |
|                          | 508793-401                              | EX2007020371                           | E508779            |                  |
|                          | 508794-401                              |  |                    |                  |
| TRW                      | 508795-401                              | EX2004030191                           |                    |                  |
|                          | 510385-401                              | EX2007020372                           |                    |                  |
|                          | 507592-401                              | EX2001100059                           |                    |                  |
|                          | 511482-401                              |  |                    |                  |
|                          | 512837-401                              |  |                    |                  |
|                          | 512839-401                              |  |                    |                  |
|                          | 512841-401                              |  |                    |                  |
|                          | 512843-401                              |  |                    |                  |
|                          | 512845-401                              | DOT-SP 12122                           | ARC SDS<br>v 1.2   | ERG Guide<br>171 |
|                          | 512847-401                              |  |                    |                  |
| ARC                      | 512849-401                              |  |                    |                  |
|                          | 512851-401                              |  |                    |                  |
|                          | 512853-401                              |  |                    |                  |
|                          | 512855-401                              |  |                    |                  |
|                          | 512857-401                              |  |                    |                  |
|                          | 512859-401                              |  |                    |                  |
|                          | 513784-401                              |  |                    |                  |
|                          | 514569-401                              |  |                    |                  |
|                          | 510183-401                              |  | Autoliv<br>SIS-002 |                  |
|                          | 510184-401                              |  |                    |                  |
|                          | 510226-401                              | DOT-SP 11650                           |                    |                  |
|                          | 511077-401                              |  |                    |                  |
| Autoliv                  | 511450-401                              |  |                    |                  |
|                          | 511452-401                              |  |                    |                  |
|                          | 511454-401                              |  |                    |                  |
|                          | 511456-401                              |  |                    |                  |
|                          | 511878-401                              |  |                    |                  |

| REVISION | DATE       | REVISED BY        | DESCRIPTION OF CHANGE  |  |
|----------|------------|-------------------|--|--|
| -        | 05/06/13   | JENNIFER BURKIZER | INITIAL RELEASE  |  |
| А        | 04/07/2015 | Robert Scott      | ECO 5316 - Add prepackaging inflator inspections/photos/and caution instructions/identify hazardous conditions.      |  |
| В        | 06/22/16   | JENNIFER BURKIZER | ECO 7096 - ADDED THE NEW BOX/COMPONENT SIZES FOR THE 6 CELL AND 12 CELL CONFIGURATIONS                               |  |
| С        | 7/25/2016  | Robert Scott      | ECO 7471 - Combined Rev A and Rev B content which was missed during processing of Rev B                              |  |
| D        | 8/23/2018  | Robert Scott      | ECO 02666 – Updated content with DOT documentation topics and added photos precluding airbags connected to inflators |  |
|          |            |                   |  |  |
|          |            |                   |  |  |
|          |            |                   |  |  |
|          |            |                   |  |  |
|          |            |                   |  |  |
|          |            |                   |  |  |
|          |            |                   |  |  |